Ball Lock Pins • self-locking, with T-Handle



Product Description

For quick fastening, locking, adjusting, changing and securing. Quickly and easily unlockable for frequently repeated connections.

All versions are corrosion resistant. When using stainless steel 1.4542: high-strength, hardened, abrasion resistant pin with high load capacity. Version with ergonomic grip.

Material

Pin part

· Stainless steel 1.4542, precipitationhardened

Handle

Aluminium, black similar to RAL 9005

Press button

· Stainless steel, black

Spring

· Stainless steel

Operation

The balls are unlocked by pressing the button.

Characteristic

Types from stainless steel 1.4542 with marking below the balls.

More information

Notes

Customized design on request.


· This product is also available in INCH dimensions.

Can easily be fitted with retaining cable EH 22400.

Further products

- · Locating Bushings, for ball lock pins and socket pins
- Locating Bushings, with flange, for ball lock pins and socket pins
- Retaining Cables
- Positioning Bushings, with collar, DIN 172 A
- Positioning Bushings, without collar, DIN
- Ball Lock Pins with T-Handle, single acting comply with NAS / MS17985

Drawing

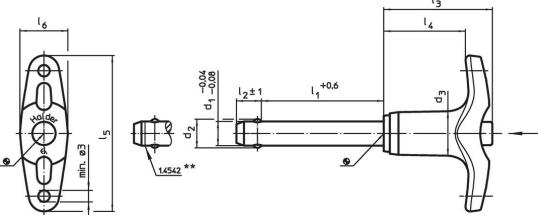

Erwin Halder KG

** Types from stainless steel 1.4542 with marking.

Page 1 of 2 www.halder.com

Published on: 13.11.2024


Order information

									Location hole	min. max.	ī	Shearing resistance,	Art. No.		
-0.04 -0.08	+0.6	d ₂	d ₃	1 ₂ ±1	13	14	15	I ₆	H11		IIIII. IIIda.		two-shear ¹⁾ min.		
[mm]									[mm]	[°C]		[g]	[kN]		
Stain	Stainless steel														
8	20	9.5	14.7	8.2	35.8	26.9	51.5	15.8	8	-30	150	38	63	22350.0034	

¹⁾ Shearing resistance similar to DIN 50141

Application example



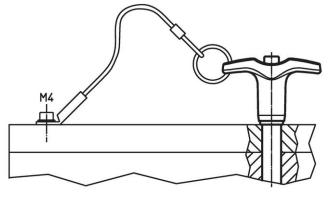

Compliance

RoHS compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 27.06.2024.

Erwin Halder KG

Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2

Published on: 13.11.2024