Rubber Endstop Buffers • cylindrical

25150.0351



Product Description

To be used as an elastic end-stop, bearing foot etc.

The hardness is 55 ±5° shore A. Further shore hardnesses (40 ±5° shore A and 70 ±5° shore A) on request.

Material

Support washer

• Steel, zinc-plated, blue chromated

Threaded bushing

· Steel, zinc-plated, blue chromated

Body


· Rubber natural caoutchouc (NR), black

More information


Further products

· Support Legs, impact cushioning

Drawing

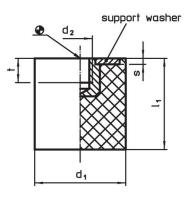

picture 1

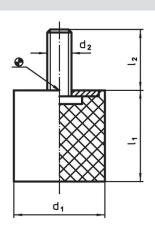


picture 2


Order information

| Dimensions | | | | | Spring rate R | Load capacity | Spring range | B | | I | Art. No. |
|---------------------------------------|----------------|----------------|---|-----|---------------|---------------|--------------|------|------|-----|------------|
| d ₁ | I ₁ | d ₂ | s | t ~ | ~ | max. | ~ | min. | max. | | |
| [mm] | | | | | [N/mm] | [N] | [mm] | [°C] | | [g] | |
| with female thread – picture 1, Steel | | | | | | | | | | | |
| 50 | 20 | M10 | 2 | 7 | 517 | 2587 | 5 | -30 | 80 | 80 | 25150.0351 |

Application example

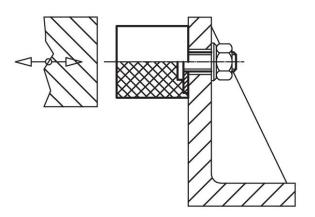

Erwin Halder KG

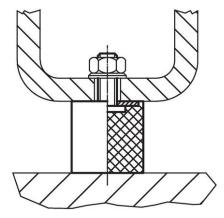



Page 1 of 2 Published on: 10.8.2024

Compliance

RoHS compliant

Contains lead - compliant according to exceptions 6a / 6b / 6c.

Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 27.06.2024.

Contains Proposition 65 substances



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 10.8.2024

Erwin Halder KG