Rubber Endstop Buffers • truncated cone form

25150.0834



Product Description

To be used as an elastic end-stop, bearing foot etc.

The hardness is 55 \pm 5° shore A. Further shore hardnesses (40 \pm 5° shore A and 70 \pm 5° shore A) on request.

Material

Support washer

Steel, zinc-plated by galvanization, passivated

Body

• NBR

Screw


Steel, zinc-plated by galvanization, passivated

More information


Further products

- · Support Legs, impact cushioning
- Silicone Endstop Buffers, truncated cone form

Drawing

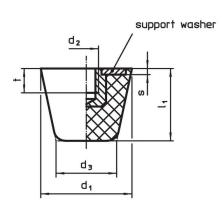

picture 1

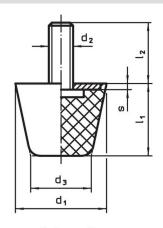

picture 2

Order information

| Dimensions | | | | | | Spring rate R | Load capacity max. | Spring range | <u>D</u> i | | I | Art. No. |
|-------------------------------|----------------|----------------|----------------|----------------|---|---------------|--------------------|--------------|------------|------|-----|------------|
| d ₁ | d ₂ | l ₂ | d ₃ | I ₁ | s | | max. | | min. | max. | | |
| [mm] | | | | | | [N/mm] | [N] | [mm] | [°C] | | [g] | |
| with screw – picture 2, Steel | | | | | | | | | | | | |
| 32 | M8 | 30 | 21 | 26 | 2 | 140 | 910 | 6.5 | -30 | 80 | 36 | 25150.0834 |



www.halder.com Page 1 of 2
Published on: 10.8.2024

Compliance

RoHS compliant

Contains lead - compliant according to exceptions 6a / 6b / 6c.

Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 27.06.2024.

Contains Proposition 65 substances



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 10.8.2024

Erwin Halder KG